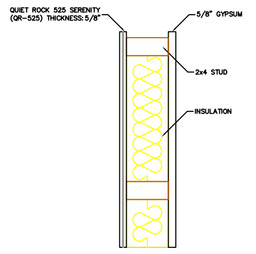

NO EXCUSE

QR-525 ON ONE SIDE, STANDARD GYPSUM ON THE OTHER,
WOOD STUD CONSTRUCTION

STC:51 FIRE:1 HOUR

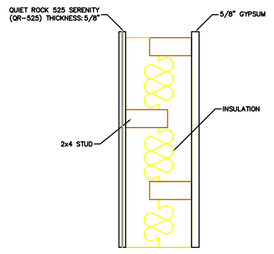

STAGGERED DEMISING WALL

QR-525 ON ONE SIDE, STANDARD GYPSUM ON THE OTHER,
STAGGERED WOOD STUD CONSTRUCTION

STC:55 FIRE:1 HOUR

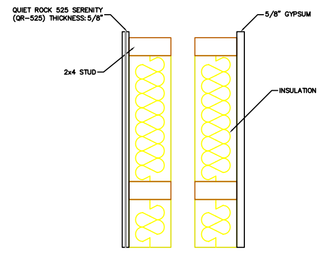

DOUBLE DEMISING WALL

QR-525 ON ONE SIDE, STANDARD GYPSUM ON THE
OTHER, DOUBLE WOOD STUD CONSTRUCTION

STC:63 FIRE:1 HOUR

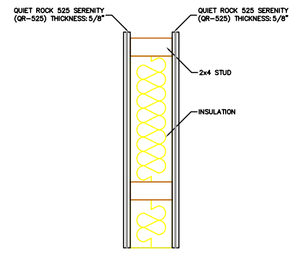

VIRTUAL DOUBLE WALL

QR-525 ON BOTH SIDES,
WOOD STUD CONSTRUCTION

STC:53 FIRE:1 HOUR

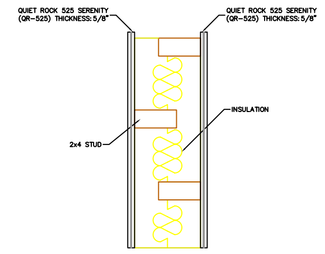

STAGGERED DEMISING WALL

QR-525 ON BOTH SIDES,
STAGGERED WOOD STUD CONSTRUCTION

STC:61 FIRE:1 HOUR

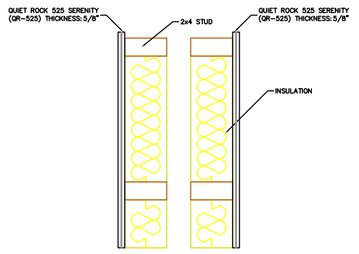

DOUBLE DEMISING WALL

QR-525 ON BOTH SIDES,
DOUBLE WOOD STUD CONSTRUCTION

STC:65 FIRE:1 HOUR

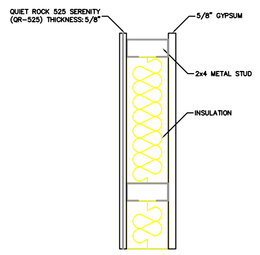

NO EXCUSE

QR-525 ON ONE SIDE, STANDARD GYPSUM ON THE OTHER,
METAL STUD CONSTRUCTION

STC:51 FIRE:1 HOUR

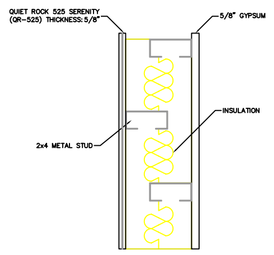

STAGGERED DEMISING WALL

QR-525 ON ONE SIDE, STANDARD GYPSUM ON THE OTHER,
STAGGERED METAL STUD CONSTRUCTION

STC:55 FIRE:1 HOUR

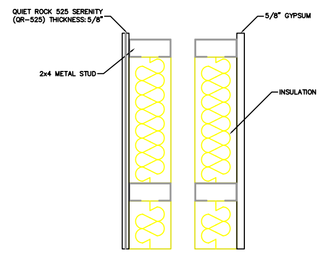

DOUBLE DEMISING WALL

QR-525 ON ONE SIDE, STANDARD GYPSUM ON THE
OTHER, DOUBLE METAL STUD CONSTRUCTION

STC:63 FIRE:1 HOUR

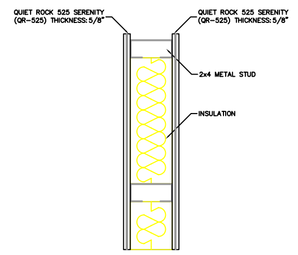

VIRTUAL DOUBLE WALL

QR-525 ON BOTH SIDES,
METAL STUD CONSTRUCTION

STC:53 FIRE:1 HOUR

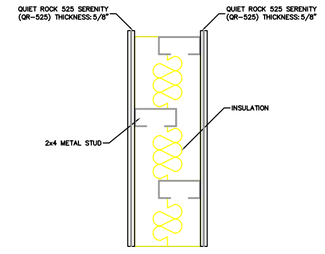

STAGGERED DEMISING WALL

QR-525 ON BOTH SIDES,
STAGGERED METAL STUD CONSTRUCTION

STC:61 FIRE:1 HOUR

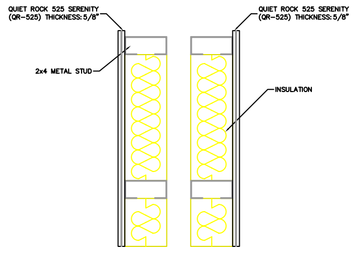

DOUBLE DEMISING WALL

QR-525 ON BOTH SIDES,
DOUBLE METAL STUD CONSTRUCTION

STC:65 FIRE:1 HOUR

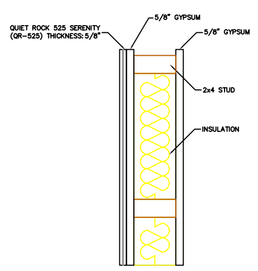

REMODELING & REHAB

QR-525 ON ONE SIDE OF EXISTING DRYWALL,
WOOD STUD CONSTRUCTION

STC:49 FIRE:1 HOUR

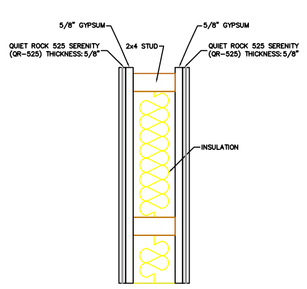

DOUBLE REMODEL & REHAB

QR-525 OVER ALL EXISTING DRYWALL,
WOOD STUD CONSTRUCTION

STC:55 FIRE:1 HOUR

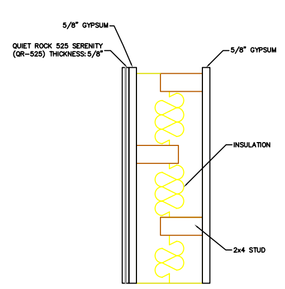

REMODELING & REHAB

QR-525 ON ONE SIDE OF EXISTING DRYWALL,
STAGGERED WOOD STUD CONSTRUCTION

STC:57 FIRE:1 HOUR

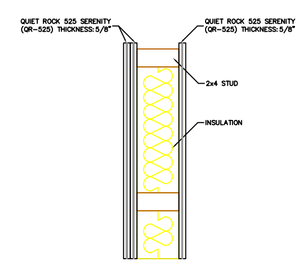

VIRTUAL DOUBLE WALL

TWO LAYERS OF QR-525 ON ONE SIDE,
ONE LAYER OF QR-525 ON THE OTHER,
WOOD STUD CONSTRUCTION

STC:56 FIRE:2 HOUR

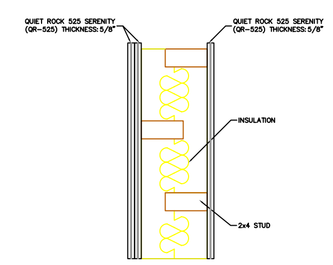

DOUBLE STAGGERED DEMISING WALL

TWO LAYERS OF QR-525 ON ONE SIDE,
ONE LAYER OF QR-525 ON THE OTHER,
STAGGERED WOOD STUD CONSTRUCTION

STC:62 FIRE:2 HOUR

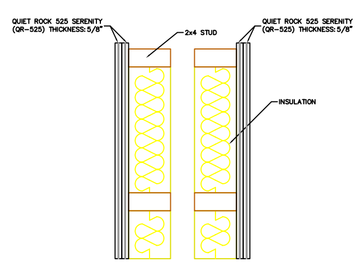

HIGHEST STC WALL

TWO LAYERS OF QR-525 ON BOTH SIDES,
DOUBLE WOOD STUD CONSTRUCTION

STC:72 FIRE:2 HOUR

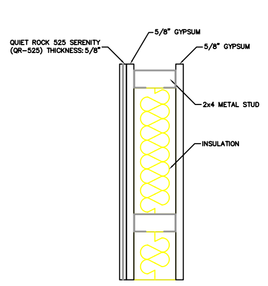

REMODELING & REHAB

QR-525 ON ONE SIDE OF EXISTING DRYWALL,
METAL STUD CONSTRUCTION

STC:49 FIRE:1 HOUR

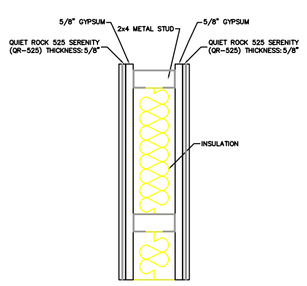

DOUBLE REMODEL & REHAB

QR-525 OVER ALL EXISTING DRYWALL,
METAL STUD CONSTRUCTION

STC:55 FIRE:1 HOUR

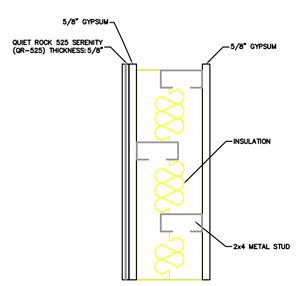

REMODELING & REHAB

QR-525 ON ONE SIDE OF EXISTING DRYWALL,
STAGGERED METAL STUD CONSTRUCTION

STC:57 FIRE:1 HOUR

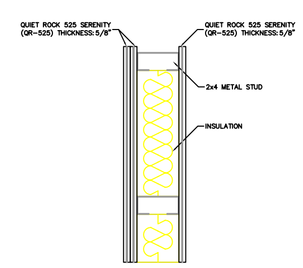

VIRTUAL DOUBLE WALL

TWO LAYERS OF QR-525 ON ONE SIDE,
ONE LAYER OF QR-525 ON THE OTHER,
METAL STUD CONSTRUCTION

STC:56 FIRE:2 HOUR

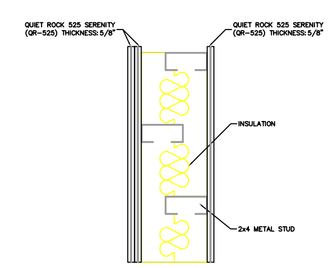

DOUBLE STAGGERED DEMISING WALL

TWO LAYERS OF QR-525 ON ONE SIDE,
ONE LAYER OF QR-525 ON THE OTHER,
STAGGERED METAL STUD CONSTRUCTION

STC:62 FIRE:2 HOUR

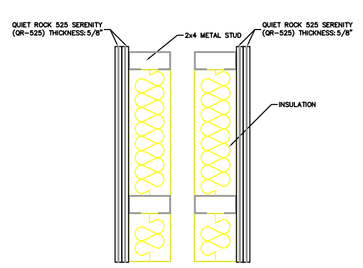

HIGHEST STC WALL

TWO LAYERS OF QR-525 ON BOTH SIDES,
DOUBLE METAL STUD CONSTRUCTION

STC:72 FIRE:2 HOUR

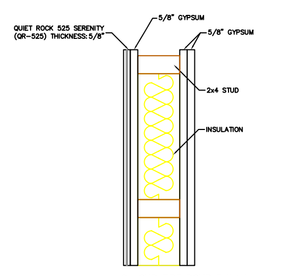

2 HOUR FIRE DOUBLE WALL

QR-525 ON ONE SIDE, TWO LAYERS
STANDARD GYPSUM ON THE OTHER,
WOOD STUD CONSTRUCTION

STC:54 FIRE:2 HOUR

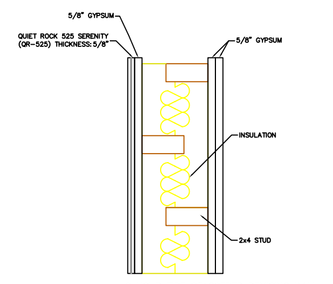

2 HOUR FIRE STAGGERED DEMISING WALL

QR-525 ON ONE SIDE, TWO LAYERS
STANDARD GYPSUM ON THE OTHER,
STAGGERED WOOD STUD CONSTRUCTION

STC:58 FIRE:2 HOUR

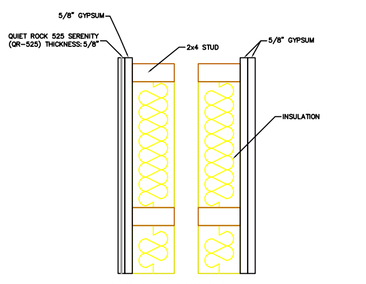

2 HOUR FIRE DEMISING WALL

QR-525 ON ONE SIDE, TWO LAYERS
STANDARD GYPSUM ON THE OTHER,
DOUBLE WOOD STUD CONSTRUCTION

STC:70 FIRE:2 HOUR

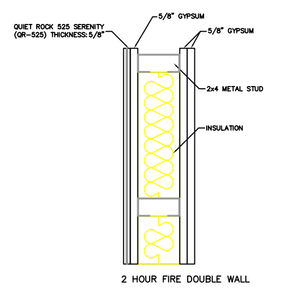

2 HOUR FIRE DOUBLE WALL

QR-525 ON ONE SIDE, TWO LAYERS
STANDARD GYPSUM ON THE OTHER,
WOOD METAL STUD CONSTRUCTION

STC:54 FIRE:2 HOUR

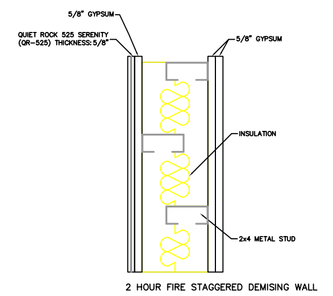

2 HOUR FIRE STAGGERED DEMISING WALL

QR-525 ON ONE SIDE, TWO LAYERS
STANDARD GYPSUM ON THE OTHER,
STAGGERED METAL STUD CONSTRUCTION

STC:58 FIRE:2 HOUR

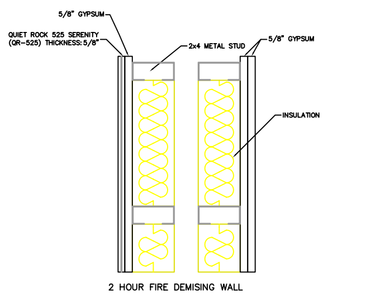

2 HOUR FIRE DEMISING WALL

QR-525 ON ONE SIDE, TWO LAYERS
STANDARD GYPSUM ON THE OTHER,
DOUBLE METAL STUD CONSTRUCTION

STC:70 FIRE:2 HOUR